

Tornado



Tornado




Tornado



Tornado



Tornado

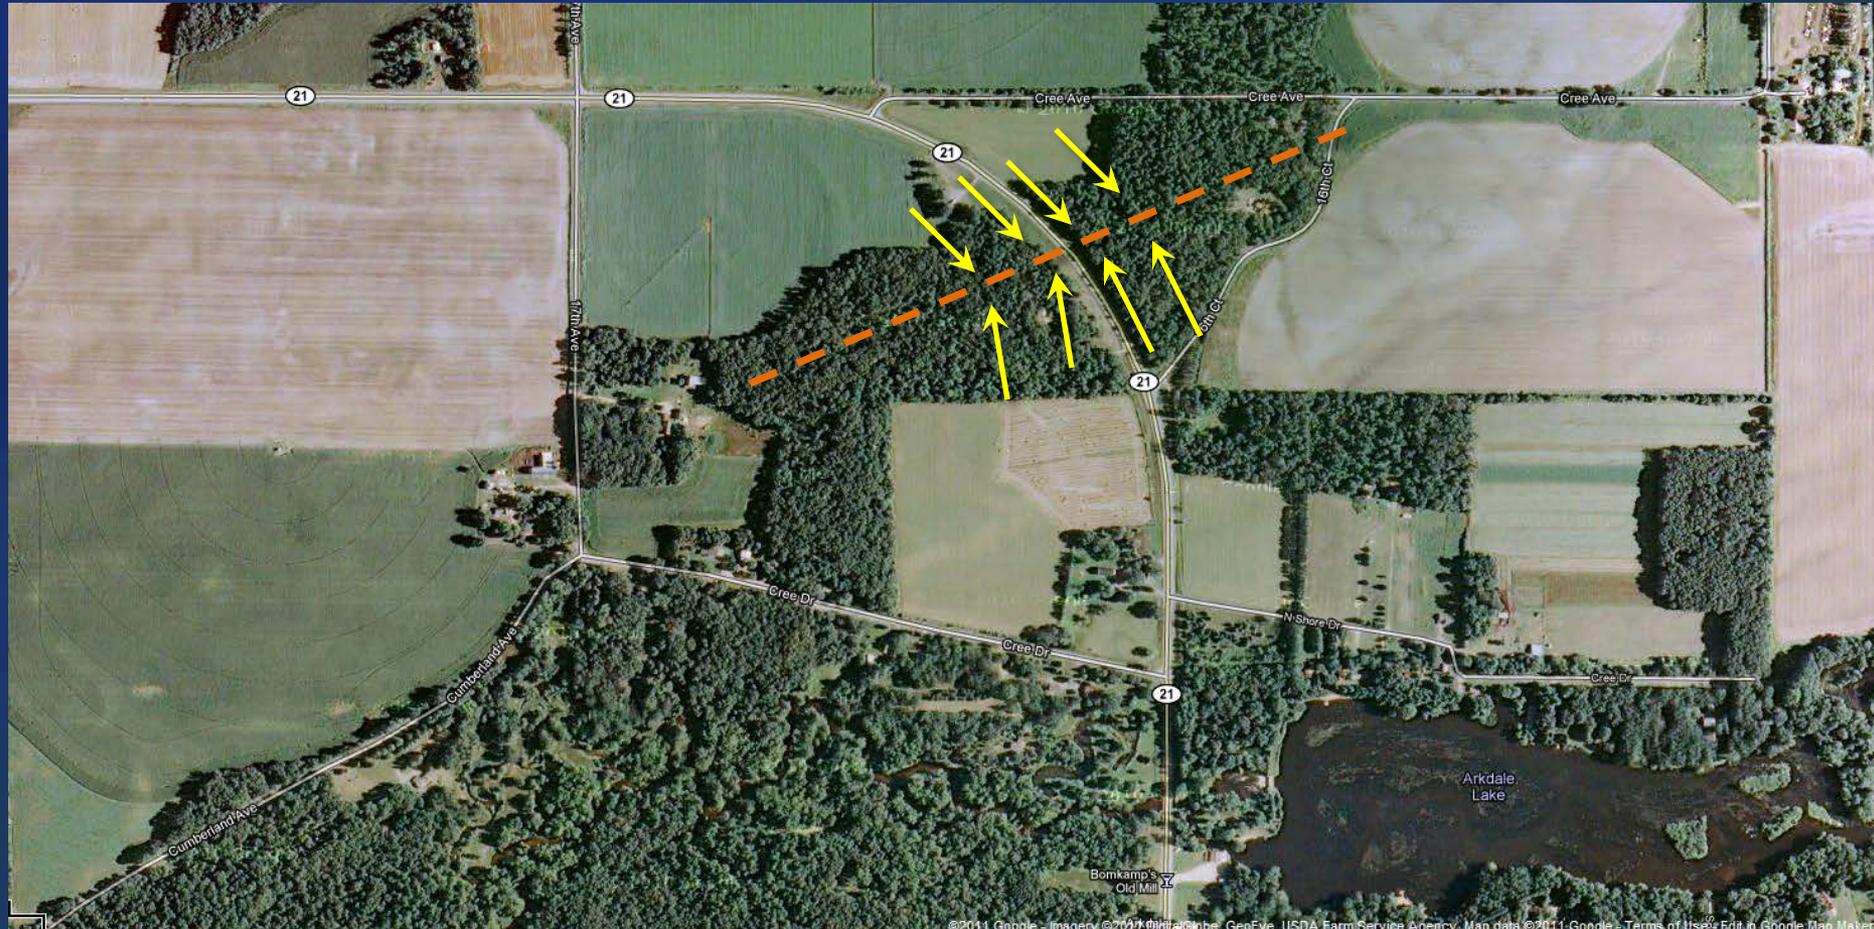

©2011 Google - Imagery ©2011 DigitalGlobe, GeoEye, USDA Farm Service Agency, Map data ©2011 Google - Terms of Use | Edit in Google Map Maker

Tornado



How would you rate these?



Enhanced Fujita (EF) Scale

- Damage scale – converted to wind/EF rating

EF Rating	Wind Range
EF 0	Up to 85 mph
EF 1	86-110 mph
EF 2	111-135 mph
EF 3	136-165 mph
EF 4	166-200 mph
EF 5	Over 200 mph

Caution: Ratings are somewhat subjective (± 1)

May require assessment team / wind experts

Damage Indicators (DI)

Damage Indicators for EF Scale

DI No.	Damage indicator (DI)
1	Small Barns or Farm Outbuildings (SBO)
2	One- or Two-Family Residences (FR12)
3	Manufactured Home – Single Wide (MHSW)
4	Manufactured Home – Double Wide (MHDW)
5	Apartments, Condos, Townhouses [3 stories or less] (ACT)
6	Motel (M)
7	Masonry Apartment or Motel Building (MAM)
8	Small Retail Building [Fast Food Restaurants] (SRB)
9	Small Professional Building [Doctor's Office, Branch Banks] (SPB)
10	Strip Mall (SM)
11	Large Shopping Mall (LSM)
12	Large, Isolated Retail Building [K-Mart, Wal-Mart] (LIRB)
13	Automobile Showroom (ASR)
14	Automobile Service Building (ASB)
15	Elementary School [Single Story; Interior or Exterior Hallways] (ES)
16	Junior or Senior High School (JHS)
17	Low-Rise Building [1-4 Stories] (LRB)
18	Mid-Rise Building [5-20 Stories] (MRB)
19	High-Rise Building [More than 20 Stories] (HRB)
20	Institutional Building [Hospital, Government or University Building] (IB)
21	Metal Building System (MBS)
22	Service Station Canopy (SSC)
23	Warehouse Building [Tilt-up Walls or Heavy-Timber Construction](WHB)
24	Transmission Line Towers (TLT)
25	Free-Standing Towers (FST)
26	Free-Standing Light Poles, Luminary Poles, Flag Poles (FSP)
27	Trees: Hardwood (TH)
28	Trees: Softwood (TS)

} Residences

} Commercial & retail structures

} Schools

} Professional buildings

} Metal buildings canopies


} Towers/poles

} Vegetation



- Plywood/OSB or wood plank roof deck
- Prefabricated wood trusses or wood joist and rafter construction
- Brick veneer, wood panels, stucco, EIFS, vinyl or metal siding
- Wood or metal stud walls, concrete blocks or insulating-concrete panels
- Attached single or double garage

DOD*	Damage description	EXP	LB	UB
1	Threshold of visible damage	65	53	80
2	Loss of roof covering material (<20%), gutters and/or awning; loss of vinyl or metal siding	79	63	97
3	Broken glass in doors and windows	96	79	114
4	Uplift of roof deck and loss of significant roof covering material (>20%); collapse of chimney; garage doors collapse inward; failure of porch or carport	97	81	116
5	Entire house shifts off foundation	121	103	141
6	Large sections of roof structure removed; most walls remain standing	122	104	142
7	Exterior walls collapsed	132	113	153
8	Most walls collapsed, except small interior rooms	152	127	178
9	All walls	170	142	198
10	Destruction of engineered and/or well constructed residence; slab swept clean	200	165	220

* DOD is degree of damage

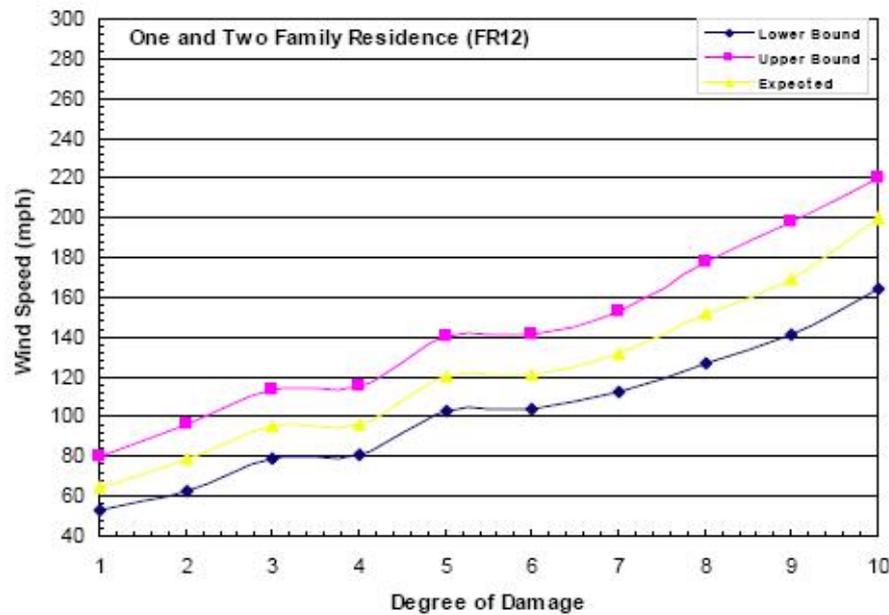


The Survey

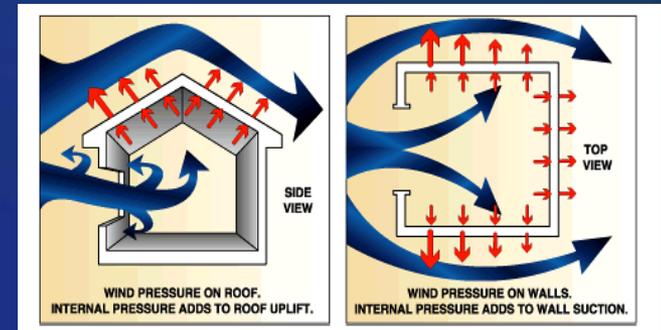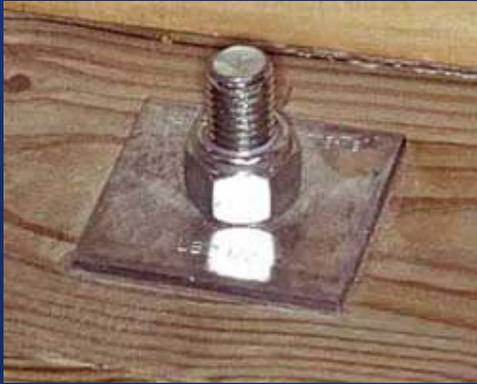

Most buildings have strong resistance to downward forces (e.g., gravity), but less resistance to upward and horizontal forces (e.g., wind).

1-2 Family Residences (FR12) Benchmarks


Failing

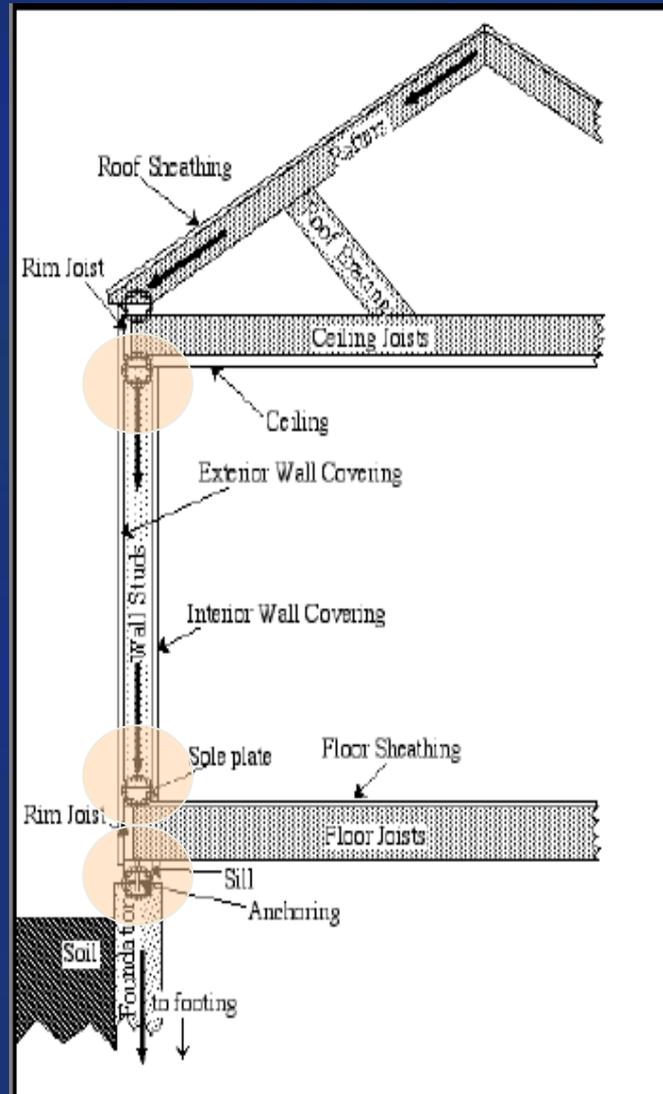

Exceeding



1-2 Family Residences (FR12) Benchmarks

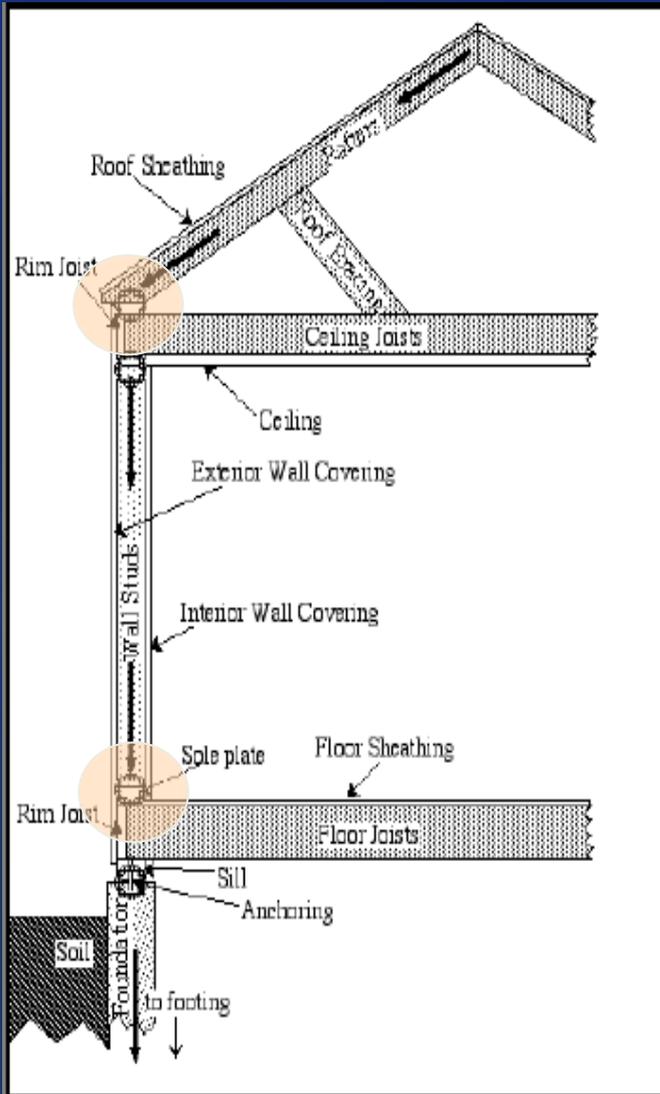

1-2 Family Residences (FR12) Benchmarks

Failing



220 lbs

Standard



414 lbs
(assuming no split wood)

Exceeding



1200 lbs

The Survey



EFO



EF1



EF2

